


APPRAISAL FAMILY: AG SMALL & LARGE BALER	
Account Manager: Bill Scott	Inspection Date: 12/22/2021
Inspector: Ryan Earl	Report Date: 12/23/2021
Location: 8131 E Warner Rd	Approved Date: 1/6/2022
	Expiration Date: 3/7/2022

MACHINE DETAILS		
Manufacturer: CC	Model: LBX432ST	S/N: 354548017
Year: 2011	Eng S/N:	Trans S/N:
SMU/Hrs: 8993	Hours Date: 12/22/2021	
Last Schedule:	Last CTS:	Last PM:
Date Oil Sample Sent to Lab:	Oil Sample:	
Recommendations:		

AG BALER CONFIGURATION			
Stock Number:	Warranty: No	Warranty Expires:	No
Large Baler: Yes	Small Baler: No	Engine:	No
PTO Drive: Yes	Total Bale Count:	Bale Size:	BX4
Bale Type: LARGE SQUARE BALER	Inline Baler: Yes	Offset Baler:	No
Hitch Type: PIN HITCH	Single Axle: No	Double Axle:	Yes
Precutter: No	Engine Tier Rating:	ECM Download:	

GENERAL APPEARANCE		
	CODE	REMARKS
Engine Enclosure	Not Applicable	
Shields	Good	AUGER DRIVE SHIELDS FACTORY BOLTS MISSING.
Fenders	Not Applicable	
Fuel Tank	Not Applicable	
Battery Mounting	Not Applicable	
Frame	Good	
Steps / Ladders	Good	
Grab Irons	Good	
Paint	Good	
Sheet Metal	Fair	
Guards / Screens	Fair	FRONT LEFT AND FRONT RIGHT COMPARTMENT GUARDS CRACKED OFF LOWER BOLT HOLES, FRONT DRIVE COMPARTMENT GUARD CRACKED IN LOWER RIGHT CORNER, FRONT LEFT LOWER COMPARTMENT DOOR EXTENSION PANEL HAS IMPACT DAMAGE.
Jack Stands	Fair	JACK STAND FOOT PLATE MISSING.
Notes		
SOS Taken	No	
Cleaning Required	Yes	GENERAL WASH AND DETAIL FOR TRANSPORT AND DELIVERY.

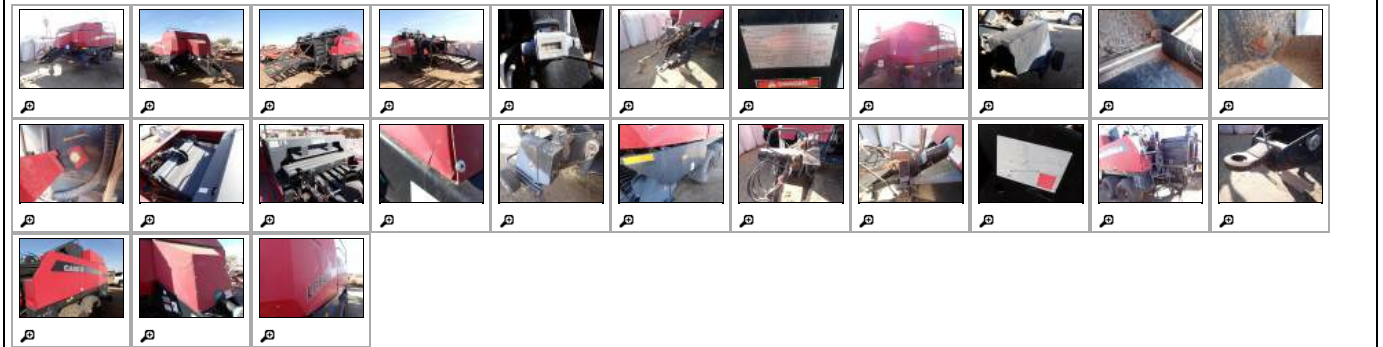

SAFETY ITEMS		
	CODE	REMARKS
Safety Decals In Place	Yes	
Safety Decals Legible	Yes	
Parts Book	No	
Safety Manual	No	
O&MM	No	MISSING BOOKS



ENGINE		
	CODE	REMARKS

Oil Leaks	No	
Blow By	No	
Knocking	No	
Oil Level OK	No	
EPA Decal	No	
Engine Type		THIS SECTION DOES NO APPLY.
Operating Condition	Not Applicable	
Turbocharger / Blower	Not Applicable	
Fuel Injection System	Not Applicable	
Governor	Not Applicable	
Engine Supports	Not Applicable	
Air Cleaners	Not Applicable	
Exhaust / Muffler	Not Applicable	
Belts / Pulleys	Not Applicable	
Belt Guards	Not Applicable	
Oil Filter Condition	Not Applicable	

ELECTRICAL SYSTEM

	CODE	REMARKS
Batteries / Cables	Not Applicable	
Starter	Not Applicable	
Alternator	Not Applicable	
Wiring	Fair	JUMPER WIRE SWITCH INSTALLED BELOW ECM, WILL NEED ASSESSED AND REPAIRED.
Pre-Heater	Not Applicable	
Lighting	Good	WORK LIGHTS ARE INTACT WITH NO VISIBLE DAMAGE, NO POWER SUPPLY TO TEST QUALITY OF LIGHTS. LEFT AND RIGHT BRAKE LIGHT FACES CRACKED BUT INTACT.



HYDRAULICS

	CODE	REMARKS
Operating Condition	NI	
Tank	Good	
Pumps	Not Applicable	
Valves	Good	
Hoses / Fittings	Fair	FITTINGS LEAKING AROUND CHUTE FOLD CYLINDER.
Control Linkage	NI	
Cylinders	Fair	CHUTE FOLD CYLINDER LEAKING PAST WIPER SEALS.
Filter Condition	NI	
Notes		
Self Contained	No	
Leaks	Yes	



AXLES

	CODE	REMARKS
Axles	Good	
Springs	Good	
Shocks	Good	
Cylinders	Good	
Tie Rods	Good	
Hubs	Good	
Wheels	Good	
Lug Nuts / Bolts Tight	Yes	



BALER

	CODE	REMARKS
Estimated Bales Of Use	8993	

Bale Length Max		
Bale Weight Max		
Bale Chute	Good	REAR BALE SHUTE ROLLER HAS MINOR IMPACT DENT.
Bale Chamber	Good	
PTO Spline	Good	
PTO Type	1000 PTO	
Knotter Type	DOUBLE KNOT SYSTEM	SIX KNOTTERS
Knotter	Good	
Knotter Lube	Good	
Pickup Lift Type (Manual / Hyd / Elect)	MANUAL	
Pickup	Fair	PICK UP TINES AND TINE BARS BENT AND RUSTED.
Twine Ball Capacity	30	
Hay Processing (Std / Pre-Cutter / Bale Slice)		
Feeder	Good	
Plunger	Good	
Drive Line	Good	DRIVE LINE HAS BUILT UP DEBRIS AROUND RIGHT SIDE ACCESS PLATE, NEEDS WASHED AND ASSESSED FOR REPAIRS.
Hay Slicer	Good	
Notes	RIGHT AUGER DRIVE HAS MINOR BEND.	
Knotter Cleaner	No	
Silage Ready	No	
Hay Precompressor	No	
Last Bale Ejector	No	
Bale Counter	Yes	
Standard Bale Chute	No	
Roller Bale Chute	Yes	
Preservative Applicator	No	



TIRES

	MAKE S/N	TREAD DEPTH 1/32"	% LIFE LEFT	RECAPPED	TREAD CUT/CHUNKS	SIDE CUTS SECTIONS
Right Front	vREDESTEING FLOTATION+	14.00	74.00	No	Yes	No
Right Rear	vREDESTEING FLOTATION+	16.00	84.00	No	No	No
Left Rear	vREDESTEING FLOTATION+	10.00	53.00	No	Yes	Yes
Left Front	BKT IMPLEMENT AW708	13.00	87.00	No	No	No
Pick Up Tires	TRAC-GARD C/T	7.25	79.00	No	No	No
Tire Size Front	500/50-17					
Tire Size Rear	500/50-17					
Average Life Left	75%					
Standard Tires	No					
High Float Tires	Yes					
	LEFT REAR TIRE HAS DEEP SIDWALL CUTS, BALDING ON OTHERS.					



SERVICE

	CODE	REMARKS
Service Needed	Yes	BALERS HASNT BEEN UTILIZED LATELY, GREASE SYSTEM NEEDS OPERATION CHECK AND NEEDS PM UPKEEP.

GENERAL REPAIRS AND REMARKS

Repairs Needed: RIGHT AUGER DRIVE HAS MINOR BEND, HAY CHUTE FOLD CYLINDER LEAK PAST WIPER SEALS AND FITTINGS, PICK UP TINES AND BARS BENT AND RUSTED, JACK STAND MISSING FOOT PLATE, FRONT AUX HYD LINE GUIDE BRACKET BENT, FRONT LEFT AND FRONT RIGHT METAL COMPARTMENT GUARDS CRACKED AT LOWER BOLT HOLES, MINOR IMPACT DENTS ON LEFT FRONT COMPARTMENT DOOR, LEFT REAR STORAGE COMPARTMENT DOOR HINGES BENT, LEFT AND RIGHT BRAKE LIGHT RED FACE COVERS CRACKED, JUMPER WIRES INSTALLED.

General comments:

