


APPRAISAL FAMILY: SKIP LOADERS			
Account Manager:Nate Harman		Inspection Date:4/3/2022	
Inspector:Ryan Earl		Report Date:4/4/2022	
Location:3310 W Durango		Approved Date:4/5/2022	
		Expiration Date:6/4/2022	
MACHINE DETAILS			
Manufacturer:NH		Model:U80	
Year:2007		S/N:LLV001993	
SMU/Hrs:3277		Eng S/N:45704420	
Last Schedule:		Trans S/N:01000789	
Date Oil Sample Sent to Lab:4/4/2022		Hours Date:4/3/2022	
Recommendations:		Last CTS:	
		Last PM:	
		Oil Sample:ENG, TRANS	
SKIP LOADER CONFIGURATION			
EROPS:	No	OROPS:	Yes
Controls, Joystick:	No	Air Conditioning:	No
Gannon:	85IN GANON BOX	Controls, Lever:	Yes
Forks:	No	Bucket Group:	1.10 CYD GP BU
Aux. Hydraulics:	No	Coupler:	No
2-Wheel Drive:	No	Hand Metering Unit:	Yes
Tire Size Rear:	19.5L-24	Integrated Toolcarrier:	No
Anti-Theft:	Yes	4-Wheel Drive:	Yes
ROPS:	Open	Side Shift:	No
		Steer, All Wheel:	No
		Engine Tier Rating:	
		Tire Size Front:	12X16.5
		Product Link:	No
		Comments:	
		ECM Download:	No
		Drive:	4WD
		Product Link:	Inquire for options on
GENERAL APPEARANCE			
CODE	REMARKS		
Radiator Grill	Fair	RADIATOR GRILL PUSHED IN AND CRACKED.	
Shroud	Good		
Engine Enclosure	Fair	RIGHT ENGINE PANEL CRACKED BUT INTACT.	
Hood / Stack	Good		
Fenders	Fair	LEFT FENDER CRACKED BUT INTACT AND OPERABLE.	
Fuel Tank	Good		
Crankcase Guard	Good		
Battery Box	Good		
Main Frame Welds	Good		
Diff. Supports	Good		
Counterweight	Good		
Pre-Cleaner Bowl	Not Applicable		
Cab	Good		
Canopy	Fair	FRONT CANOPY CRACKED AND MISSING.	
Steps / Ladder	Fair	RIGHT AND LEFT STEPS BENT.	
Grab Irons	Good		
Paint	Fair	PAINT IS FADED AND OXIDIZED.	
Sheet Metal	Good		
S.O.S. Taken	Yes	ENG, TRANS	
Cleaning Required	Yes	GENERAL WASH AND OPERATOR STATION DETAIL FOR TRANSPORT AND DELIVERY, EXCESSIVE ASPHALT IN LOADER BUCKET.	
Horn	Yes		
Notes			
			
SAFETY ITEMS			
CODE	REMARKS		
Safety Decals In Place	Yes		
Safety Decals Legible	Yes		
Back-up Alarm	Fair	BACK UP ALARM INOPERABLE.	
ROPS	Yes		
Notes			




GAUGES, OPERATOR STATION, CONSOLE

	CODE	REMARKS
Dash Console	Good	
Meter	Good	
Gauges	Good	
Switches	Fair	SWITCHES ARE FADED AND UNREADABLE, AVERAGE FOR AGE AND HOURS ON MACHINE.
Wipers	Not Applicable	
Heater	Not Applicable	
Air Conditioner	Not Applicable	
Interior Lights	Not Applicable	
Radio / Speakers	Not Applicable	
Seat Cushions / Arm Rests	Fair	1 PIECE SEAT CUSHION CRACKED.
Floor Boards	Fair	FLOOR MOUNT HARDWARE MISSING.
EMS Panel / Warnings	Good	
Doors	Not Applicable	
Door Latches	Not Applicable	
Glass / Mirrors	Fair	REAR VIEW MIRROR MISSING BUT MOUNT BRACKET STILL ATTACHED.
Hyd Controls	Good	
Seat Belt	Good	
Parts Book	No	
Safety Manual	Yes	
O&MM	Yes	
ROPS Cert Plate	Yes	
Notes		



ENGINE

	CODE	REMARKS
Oil Leaks	No	NO ENGINE LEAKS OBSERVED, LEAK AROUND TRANS/ENG COMPARTMENT, SEE TRANSMISSION SECTION.
Blow By	No	
Knocking	No	
Compression In Radiator	No	
Water In Oil	No	
Fluid Levels OK?	Yes	
EPA Decal	Yes	
Anti-Freeze Color	CRACKED	ANTI-FREEZE OVERFLOW BOTTLE CRACKED APART AND DRY ROT.
Oil Press (H/L/N)	NORMAL	
Smoke (B/D/L/W)	NORMAL	
Operating Condition	Good	
Turbocharger / Blower	Good	
Fuel Injection System	Fair	LEAK/SEEP FROM FUEL INJECTION PUMP, NEEDS WASHED AND ASSESSED.
Governor	Fair	GOVERNOR FOOT PEDAL BENT AND HAND GOVERNOR LINKAGE HARD TO ADJUST.
Engine Supports	Good	
Air Cleaners	Fair	AIR FILTER HOUSING CRACKED AND HELD BY WIRE.
Exhaust / Muffler	Good	
Belts / Pullys	Good	
Oil Filter Condition	Good	
(Cut)	NI	
Notes		




COOLING SYSTEM

Radiator	Good	
Coolers	Good	
Hoses	Good	
Water Pump	Good	
Fan	Good	
Fan Drive	Good	
Belts / Pulleys	Good	
Notes		
Leaks	No	NO LEAKS OBSERVED.



ELECTRICAL, STARTING AND CHARGING SYSTEM

	CODE	REMARKS
Batteries / Cables	Good	
Starter	Good	
Alternator	Good	
Wiring	Good	
Pre-Heater	Good	
Lighting	Fair	LEFT AND RIGHT HAZARDS INOPERABLE, LEFT HAZARD AND LIGHT GROUP CRACKED AND HELD BY TAPE.
Notes		
Ether Aid	No	
Rotating Beacon	No	
Signal Lights	Yes	
Warning Lights	Yes	
Block Heater	No	







TRANSMISSION

	CODE	REMARKS
Trans. Type	4-SPEED STD SHIFT.	
Case	Good	
Controls	Good	
Seals	Good	
Torque Converter	Good	
Universal Joints	Good	
Temp / Pressure Gauges	Good	
Lines / Fittings	Good	
Transmission Forward Shifts	Good	
Transmission Reverse Shifts	Good	
Pump	Good	
Cooler	Good	
Oil Filter Condition	Good	
(Cut)	No	
Operating Condition	Fair	TRANSMISSION HARD SHIFT INTO LOWER GEARS, NEEDS ASSESSED FOR REPAIRS.
Transmission Noisy	No	
Leaks	Yes	LEAK AROUND TRANSMISSION TORQUE CONVERTER AND ENGINE OIL PAN GROUP, CAN BE ASSESSED WHEN TRANSMISSION OPERATING CONDITION IS TROUBLESHOT.
Notes		



STEERING

	CODE	REMARKS
Front Axle	Fair	LEFT AND RIGHT FRONT AXLE FLANGE PINS HAVE EXCESSIVE MOVMENT WITH POSSIBLE LEAKING, NEEDS WASHED AND ASSESSED FOR REPAIRS.
Steering Linkage	Good	
Tie Rods & Ends	Fair	LEFT AND RIGHT TIE ROD DUST BOOTS TORN.
Steering Cylinder	Good	
Pumps & Valves	Good	


Hand Meter Unit	Good
Notes	
   	

BRAKES


	CODE	REMARKS
Brake Drums / Rotors	WET-DISC	
Brake Linkage	Good	
Pedal	Good	
Leaks	Good	
Parking Brake	Good	
Holds In What Gear	3RD	
Notes		

FINAL DRIVES

	CODE	REMARKS
Wheel Lugs & Rims	Good	
Front Axle	Good	
Front Final Drives	Good	
Rear Axle	Good	
Rear Final Drives	Good	
Differentials	Fair	REAR DIFFERENTIAL HOUSING LEAK.
Trunnion	Good	
Notes		

**HYDRAULICS**

	CODE	REMARKS
Operating Condition	Fair	HYD FUNCTION IS ABRUPT.
Lift Cylinders	Fair	LEFT AND RIGHT LOADER LIFT CYLINDER PINS BEARINGS AND BUSHINGS HAVE MODERATE MOVEMENT AND WEAR.
Tilt Cylinder	Good	
Gannon Cylinders	Good	
Hoses / Lines	Fair	TUBE TO LOADER TILT CYLINDER HAS IMPACT DAMAGE, BENT ON BOTTOM.
Pumps & Valves	Fair	HYD CONTROL VALVE BODY LEAK, NEEDS WASHED AND ASSESSED FOR REPAIRS.
Control Linkage	Good	
Bucket & Hoist Kickouts	Good	
Accumulator Charge - Ride Control	Not Applicable	
Filter Condition	Good	
(Cut)	No	
Leaks	Yes	
Notes		

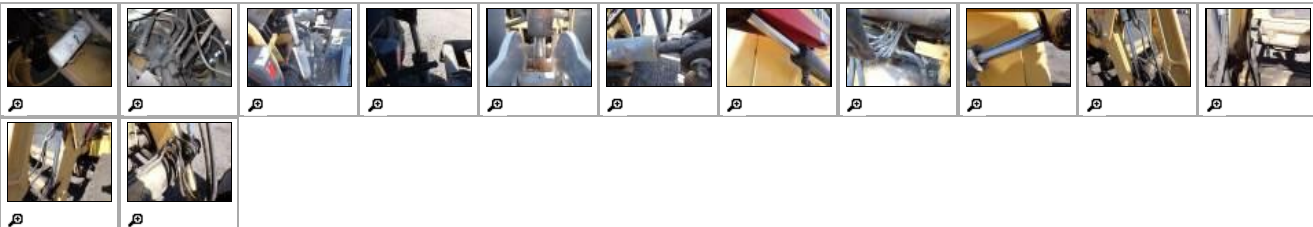
**ATTACHMENTS / WORK TOOLS**

	CODE	REMARKS
Fork	No	
Other	No	
Other	No	
Operating Condition	Not Applicable	
Notes	THIS SECTION DOES NOT APPLY.	

FRONT BUCKET

	CODE	REMARKS
Cutting Edges	Good	

Bucket Bottom	Fair	LEFT LOADER BUCKET HEEL PLATE WORN THIN AND STARTING TO CRACK ON REAR BOTTOM OF BUCKET, RIGHT IS WORN, BOTH AVERAGE FOR AGE AND HOURS ON MACHINE.
Bucket Sides	Good	
Bucket Top	Fair	BUCKET TOP EYELETS BENT.
Bucket Linkage	Fair	BUCKET LINKAGE OUT OF ADJUSTMENT WITH MODERATE MOVEMENT.
Loader Pins & Bushings	Fair	LOADER PINS AND BUSHINGS HAVE AVERAGE MOVEMENT FOR AGE AND HOURS ON MACHINE, LEFT AND RIGHT LAODER LIFT CYLINDERS HAVE MODERATE MOVEMENT, SEE HYD SECTION.
Loader Frame	Good	
Segments	Good	
Bucket Floor	NI	BUCKET FLOOR COVERED IN DRY ASPHALT, NEEDS REMOVED-WASHED-AND ASSESSED FOR PROPER INSPECTION.
Multi Purpose Cylinders	Not Applicable	
Quick Attach	No	
Bucket Capacity	1.10 CYD	
Bucket S/N	286930	
Notes		
Notes		

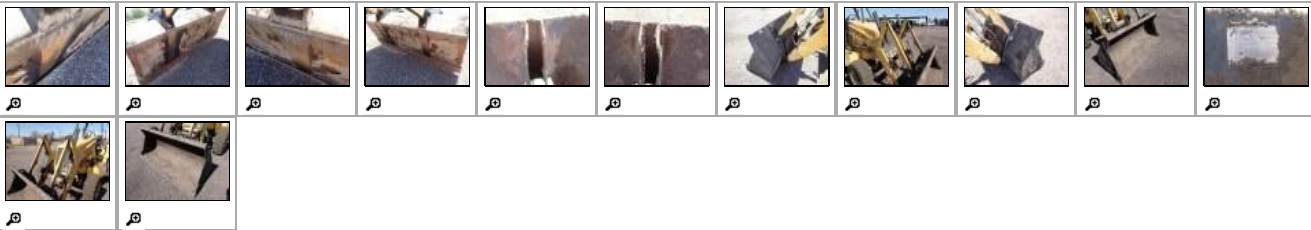


GANNON

	CODE	REMARKS
Cutting Edges	Fair	LEFT GANON BOX WEAR PLATE HARDWARE PULLING APART, AND LEFT AND RIGHT GANON BOX WEAR PLATES WORN TO BOX BLADE BASE EDGE.
Teeth / Adapters	Good	4 OF 8 SCARIFIER SHANKS MISSING.
Gannon Frame	Good	
Gannon Sides	Good	
Gannon Linkage	Fair	LEFT GANON HITCH GUIDE PADS MISSING.
Gannon Mounts	Good	
Coupler	Good	
Gannon Width	85IN	
Gannon S/N	G056400	
Notes		



TIRES

	MAKE S/N	TREAD DEPTH 1/32"	% LIFE LEFT	RECAPPED	TREAD CUT/CHUNKS	SIDE CUTS SECTIONS
Right Front	Galaxy Muddy Buddy	29.00	69.00	No	No	No
Right Rear	Galaxy EZ Rider R4	20.00	59.00	No	No	No
Left Rear	Galaxy EZ Rider R4	20.00	59.00	No	No	No
Left Front	Galaxy XD2020	12.00	55.00	No	No	No
Front Tire Size	12X16.5					
Rear Tire Size	19.5L-24					
Average Life Left	61%					
Spare	No					
Tires Needed						
Notes	TIRES DISPLAY WEAR BUT STILL HAVE LEFT LEFT.					
Notes						



SERVICE

	CODE	REMARKS
Service Needed	PM	NO MARKS ON ANY FILTERS DISPLAYING LAST PM SERVICE.

GENERAL REPAIRS AND REMARKS

Repairs Needed: LEFT REAR DIFFERENTIAL HOUSING LEAK, TRANSMISSION LEAK, TRANSMISSION HARD SHIFT F&R, HYD CONTROL VALVE LEAK, LEFT GANON HITCH PADS MISSING, LEFT AND RIGHT GANON SIDE CUTTERS WORN TO BOX BLADE EDGE, 4 OF 8 SCARIFIERS MISSING, ANTI-FREEZE OVERFLOW BOTTLE CRACKED, FUEL LEAK/SEEP, AIR FILTER HOUSING CRACKED AND HELD BY WIRE, MULTIPLE GENERAL APPEARANCE REPAIRS.

General comments:

